

Firmware Update Procedure for NL-SW-LTE-TSVG-B

NimbeLink Corp

Updated: August 2017

© NimbeLink Corp. 2017. All rights reserved.

NimbeLink Corp. provides this documentation in support of its products for the internal use of its current and prospective customers. The publication of this document does not create any other right or license in any party to use any content contained in or referred to in this document and any modification or redistribution of this document is not permitted.

While efforts are made to ensure accuracy, typographical and other errors may exist in this document. NimbeLink reserves the right to modify or discontinue its products and to modify this and any other product documentation at any time.

All NimbeLink products are sold subject to its published Terms and Conditions, subject to any separate terms agreed with its customers. No warranty of any type is extended by publication of this documentation, including, but not limited to, implied warranties of merchantability, fitness for a particular purpose and non-infringement.

Skywire and NimbeLink are trademarks of NimbeLink Corp. All other trademarks appearing in the document are the property of their respective owners.

Table of Contents

Introduction	4
Firmware Update Procedure	4
Install USB device drivers on a Windows PC	4
Plug Modem into Development kit	4
Connect USB cable from Kit to PC	4
Apply Power	4
Recognize Modem	4
Run Update Application	4
Select Program default settings	5
Remove USB cable	8
Remove Power	8
Remove Modem	8
Check New Firmware Version	8

1. Introduction

As cellular carriers and chipset providers update the network and products that support it, new features get added that are desirable to enable in NimbeLink modems. This document provides instructions on how to update the NL-SW-LTE-TSVG Skywire modem running firmware 17.01.571 to the 17.01.573 firmware version that ships on the NL-SW-LTE-TSVG-B.

2. Firmware Update Procedure

2.1 Install USB device drivers on a Windows PC

Installation files are available on the web here:

http://nimbelink.com/wp-content/uploads/2014/08/Telit_USB_Driver_Win_Desktop_UF.00.01.zip

We have found this to work well on Windows 7 and Windows 8 PCs.

2.2 Plug Modem into Development kit

This guide is written for users using the NL-SWDK development kit. There are additional development kits that can be used for firmware updates, but are not documented here.

2.3 Connect USB cable from Kit to PC

Connect the USB cable to USB connector J5 and the PC.

2.4 Apply Power

Plug power supply into connector/barrel jack J3 and turn on the modem by pressing the ON_BTN for 1-2 seconds.

2.5 Recognize Modem

After applying power, the modem takes about 15-16 seconds before the USB ports are initialized and recognized by the operating system.

2.6 Run Update Application

The released firmware update package is available for download here:


http://nimbelink.com/Documentation/Skywire/4G_LTE_Cat_3/1001501_NL-SW-LTE-TSVG-B_FW.zip

Extract the files in the .ZIP package to a local directory on your PC.


Run the LE910VZN_17.01.573_SVG_CUST_024_10_TFI.exe file.

2.7 Select Program default settings


Click 'English'

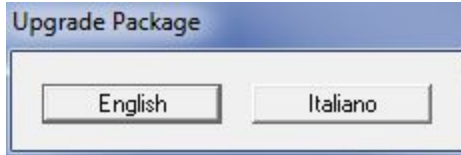



Review and Accept the license agreement, then click 'OK'


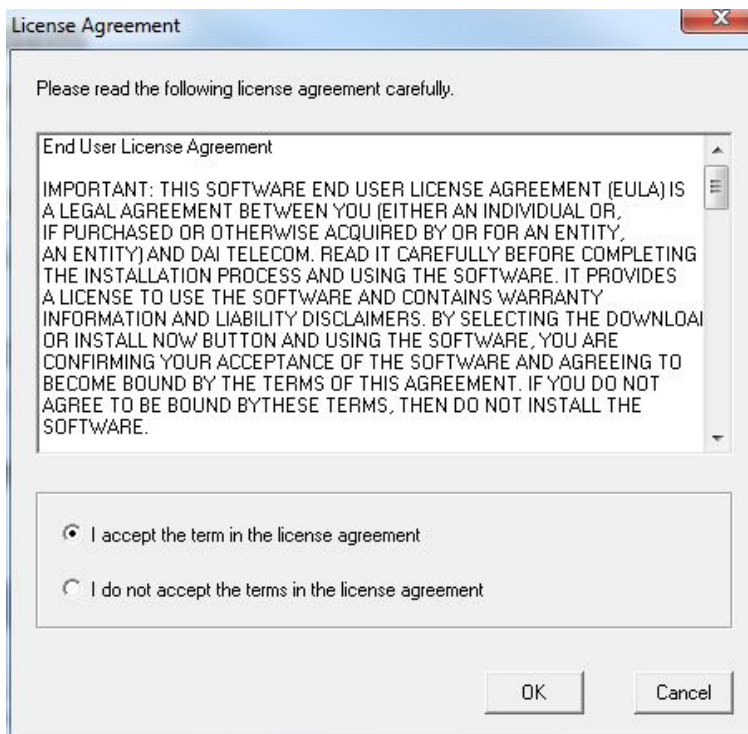


Review information regarding power and click 'OK'

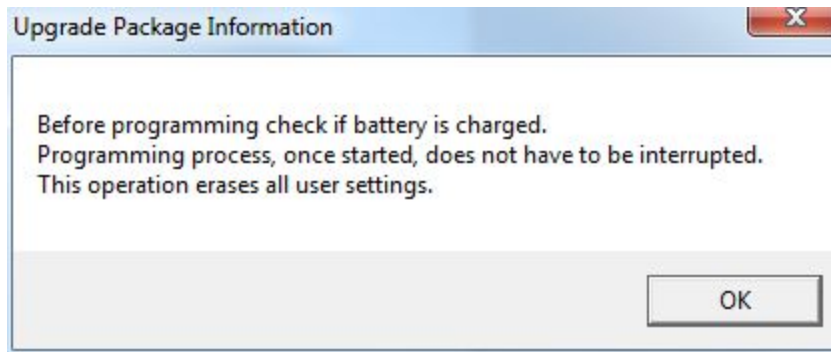


The application will search for the modem and when it finds it, it will then backup data to PC, switch to download mode, download the new data, reset the modem, then provide pass/fail status. Below are a series of screens that will be displayed while the sequence executes.

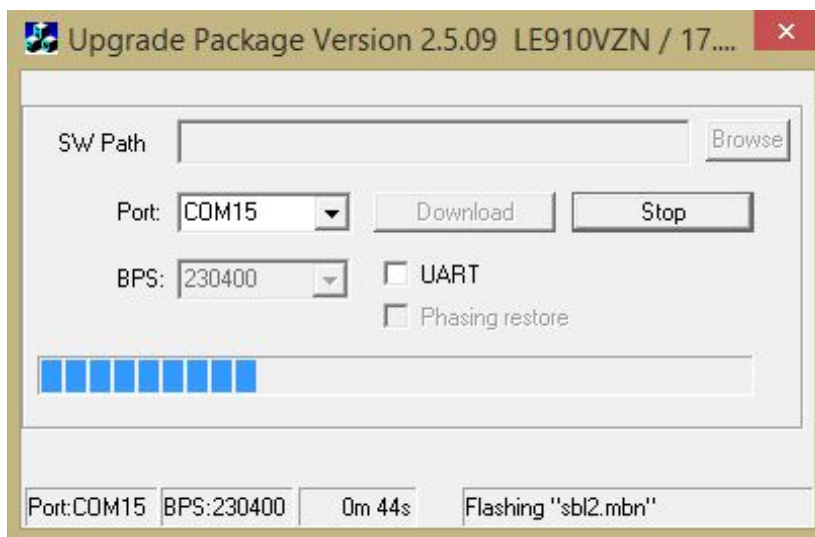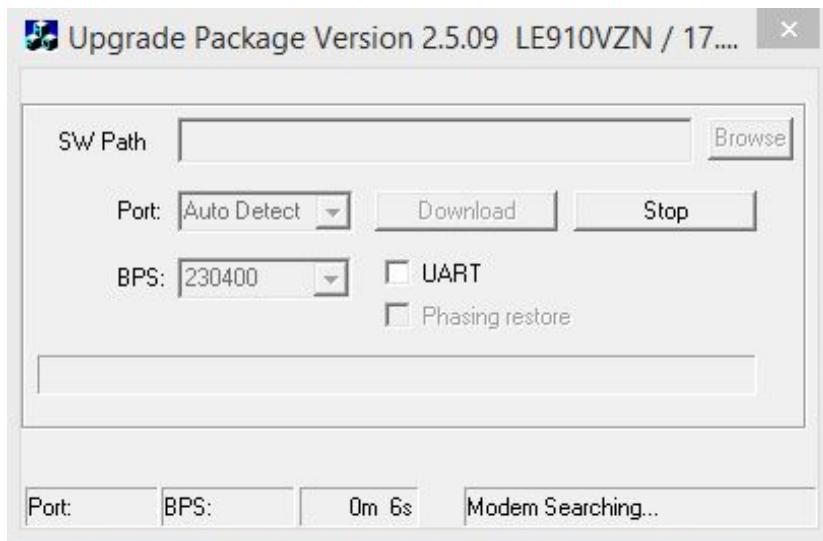


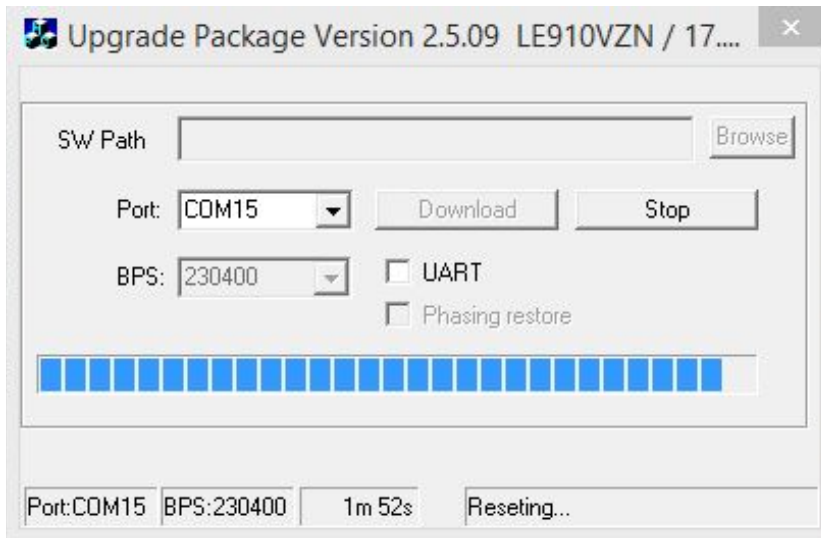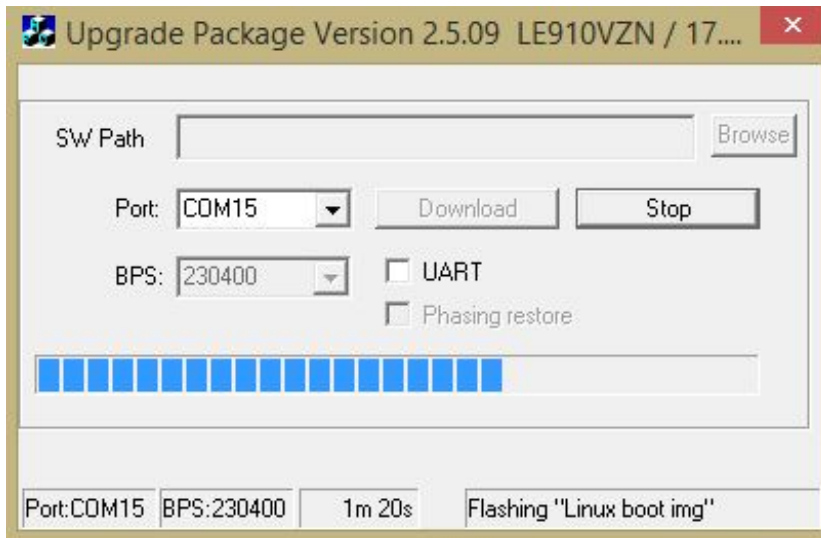

When the process completes, the notification below will be displayed. Click 'OK' to get to the main application screen.

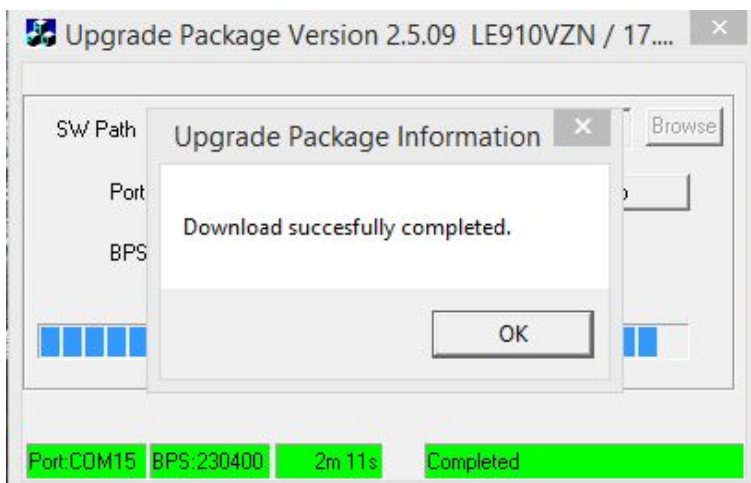

Click the 'X' in the upper right hand corner to close the application.

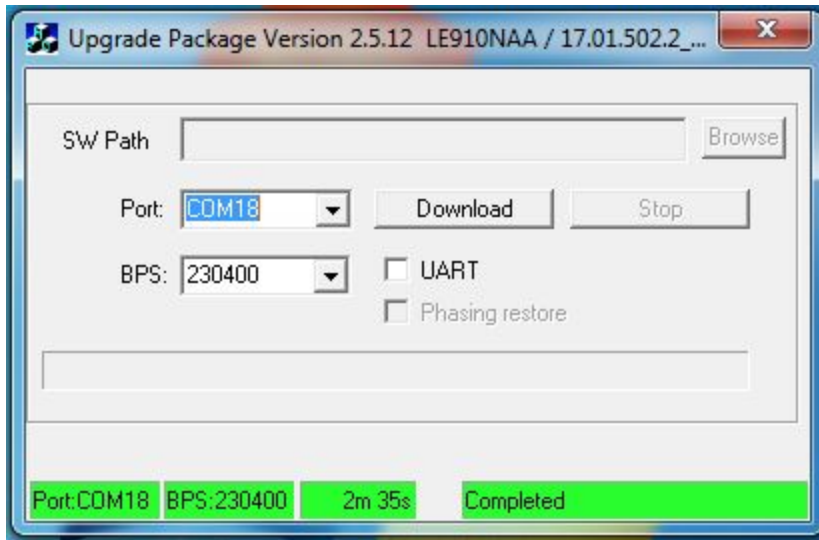

2.8 Remove USB cable

2.9 Remove Power

2.10 Remove Modem

The modem can be installed back into custom hardware or a NimbeLink development kit.

2.11 Check New Firmware Version

If you want to confirm the new firmware version is running on the device, you can issue the command:

AT+CGMR

Response:

17.01.573

OK